**Print Form** 

## Missouri Department of Transportation Bridge Inspection Finding that Requires Follow-Up Action (FAR)

Bridge L02	263	Regi	on 5	District	6	Inspection Date	2011-07-06
County Sai	nt Louis	Route	I-44 WB	Over/Under	Merameo	:	
Inspector (s)	Raithel, Rickerson		Condition Ratings	(58) Deck 6	(59) Super 5	(60) Subst 4	(61) Bnk Channel NA (62) Culv NA
				NA		Condition rating lowered from	NA as a result of this finding.
			Comment	NA		Condition rating lowered from NA as a result of this finding.	
Deficiencie		•			posed rel	bar, undermining Ty	pe C bearing 3". Blocking is
Inspector's	Recommended	l Plan of	Action (che	ck all that app	oly):		
Expedited Blocking / Shoring X Expedited Repair							
Repair Proposal Submitted for Review							
	pacity Evaluation F Note: Include Secti		ta		C Oth	ler:	
Work Assigned to: 🗌 Regional Crew 📄 District MT 👘 Central Office 👘 Other:							
Suggested time for repairs: Months: 1 Notification Date 2011-07-11							
Plan of Acti	on:	. Lous Metr	o Bridge Crev	vs			
Plan of Act	ion implemente	ed by: [	Inspector	SBIE Oth	er: DBE		
Status of Re	Crew made tower for su go under ha removed to	ipport , ren alf bearing,	noved delami cleaned reba ripe forms. Pi	nated concrete r , concrete, coa cs will follow at	from unde ted with s a later dat	er south exterior ste aline, formed up , po te.	work, set two leg steel p cap bearing , only had to oured back with rapid set, Struc Res Br Insp
	Engineer Engineer	<sup>×</sup> Enginee	Tech	neer 🖄 En IWA Other:	gineer	Engineer	Manager Engineer